

SERVICE BULLETIN


Bulletin No. 001

Issue Date: June 13, 2005

Product: Model J Booster Heaters

Purpose: To provide field service technicians with specific information regarding product service or operation.

Background: The transformer located on the T1000 control board can develop a hairline crack in the left hand corner solder joint (see photo). This prevents power from being supplied to the display module, resulting in the booster heater becoming inoperable.

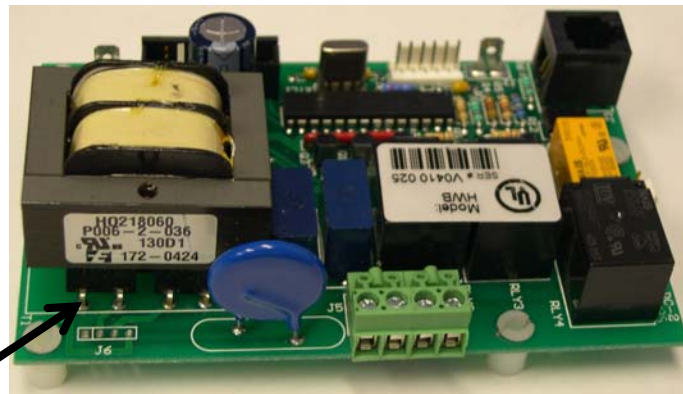

Hairline Crack

Current Status: All new T1000 control boards have an improved transformer mounting. Additionally, all circuit boards now utilize a rubber grommet and stand-off.

Remarks/Action: The transformer solder joint can be repaired in the field by re-soldering the cracked joint. If repair can not be easily performed, then replace the T1000 and return the component to Hubbell.